



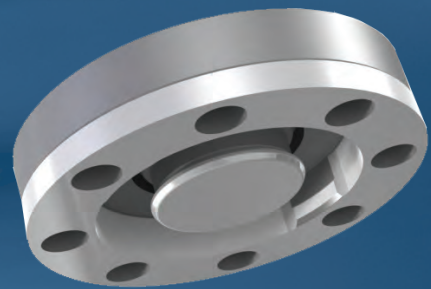

**ROEMHELD**  
HILMA ■ STARK

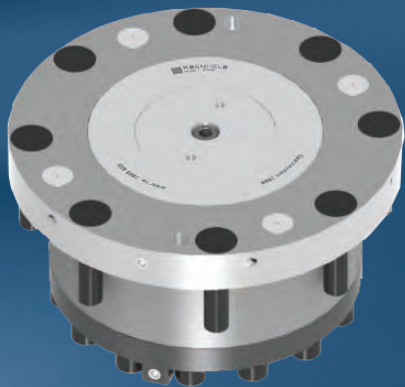

## Zero point clamping system • system 3000

- unique push-on very strong automatic monitoring
- flush mounted SPEEDY and spigot handling without interfering contour
- 50kN retention force
- suitable for automation
- all functions can be polled






# GO!

## ***Maximum productivity***

- With the system 3000 you will increase your production times to a maximum.
- This clamping element stands for the highest requirements in automation.

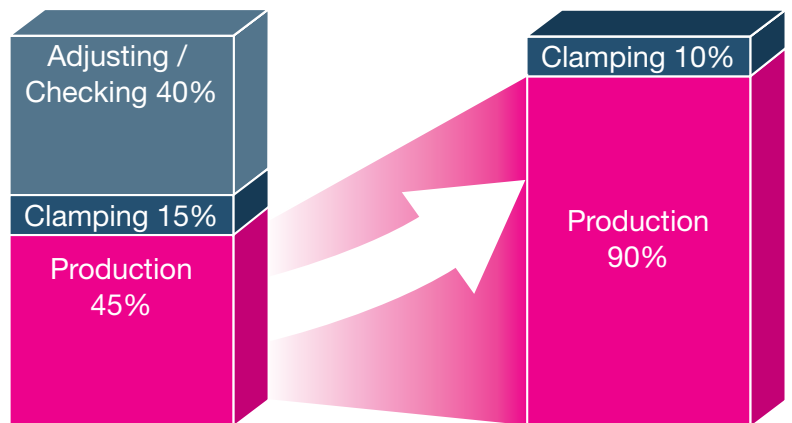


## ***Maximum flexibility***

- system 3000 has a uniform interface that can be arranged in various ways.
- system 3000 features a compact design, easy assembly as well as fast changing cycles.

## ***Maximum safety***

- Double-action zero point clamping system with small size and high clamping force.
- Easy handling, as the pallet can be moved to the clamping element with practically no lifting.

**system 3000 – will pay for itself in a very short time.**

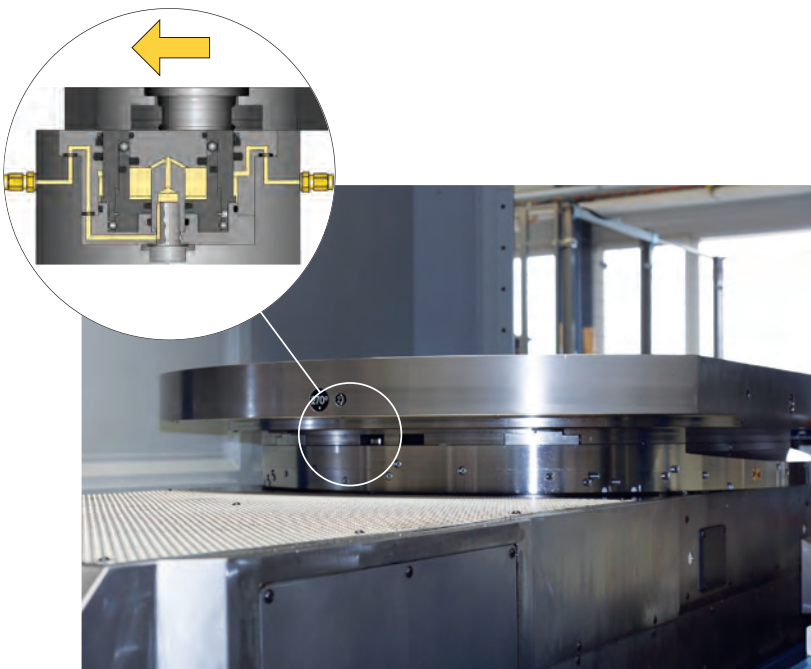



Contents system 3000

<b>Information</b>	STARK clamping systems overview Contents system 3000 Technical data Function description	..... i.4 ..... i.5 ..... i.6 ..... i.9
<b>system 3000</b>	<ul style="list-style-type: none"><li>● Standard</li><li>● Standard</li><li>● Standard</li><li>● Standard</li></ul>	<b>Order no.</b> 3000 850 ..... 1.1 3000 851 ..... 1.2 3000 852 ..... 1.3 3000 853 ..... 1.4
<b>Clamping spigot</b>	<ul style="list-style-type: none"><li>● With zero point</li><li>● With equaliser</li><li>● Without centring</li><li>● Without centring ± 1mm</li></ul>	3000 818 ..... 2.1 3000 811 ..... 2.1 3000 812 ..... 2.2 3000 812-1 ..... 2.4
<b>Accessories</b>	Ball ring <ul style="list-style-type: none"><li>● Round wire ring with 36 balls</li></ul>	3000 901 ..... 2.4



## Technical data - Transparency from the start

system 3000 Order no.		3000 850	3000 851	3000 852	3000 853
Catalogue page		1.1	1.2	1.3	1.4
Polling pin			●		
4 raised supports and clearing device		●	●		
Oil feed, flange		●	●	●	●
Oil feed, base					●
Maintenance interval	Cycles	500,000	500,000	500,000	500,000
Max. clamping force <sup>1</sup>	[ N ]	50,000	50,000	50,000	50,000
Min. release pressure	[ bar ]	20	20	20	20
Max. operating pressure	[ bar ]	200	200	200	200
Oil volume for clamping	[ cm <sup>3</sup> ]	75	75	75	75
Oil volume for releasing	[ cm <sup>3</sup> ]	23	23	23	23
Air volume - clearing device	[ l/min. ]	80l/min 6bar	80l/min 6bar		
Operating temperature	[ °C ]	+10 to +80	+10 to +80	+10 to +80	+10 to +80
Min. permissible clamping time	[ s ]	1	1	1	1
Min. permissible release time	[ s ]	1	1	1	1
Radial pre-positioning <sup>2</sup>	[ mm ]	± 0.4	± 0.4	± 0.4	± 0.4
Axial pre-positioning	[ mm ]	+0.1	+0.1	+0.1	+0.1
Repeatability <sup>3</sup>	[ mm ]	< 0.005	< 0.005	< 0.005	< 0.005
System accuracy <sup>4</sup>	[ mm ]	< 0.01	< 0.01	< 0.01	< 0.01
Weight	[ kg ]	approx. 3.75	approx. 4.45	approx. 3.75	approx. 3.75

### <sup>1</sup> Clamping force

Clamping force refers to the load up to which the zero point is guaranteed. The clamping force stated must not be exceeded. Due to the adjustable clamping force, there is a maximum, at the maximum clamping pressure (see table below).

### <sup>2</sup> Radial pre-positioning

The loading device must, during manual and automated loading, yield without the application of force.

### <sup>3</sup> Repeatability

Repeatability refers as a rule to the accuracy with which the same pallet in a specific orientation is changed on the same interface.

### <sup>4</sup> System accuracy


System accuracy refers to the accuracy obtained on changing several pallets, e.g. on different machines.

**Variable clamping force with system 3000.**

The continuously adjustable clamping force makes possible optimal clamping. By adjusting the clamping pressure, unnecessarily high forces are not applied. As a result the receptacles or pallets do not need to be as strong, depending on the machining - the result is advantages in handling and price.

A key aspect, e.g. during milling, is ensuring an adequate, but not excessively high clamping force during the machining to be able to absorb the machining forces. Clamping based on shape and force is ideal.

Depending on the clamping pressure, there is a clamping force of:

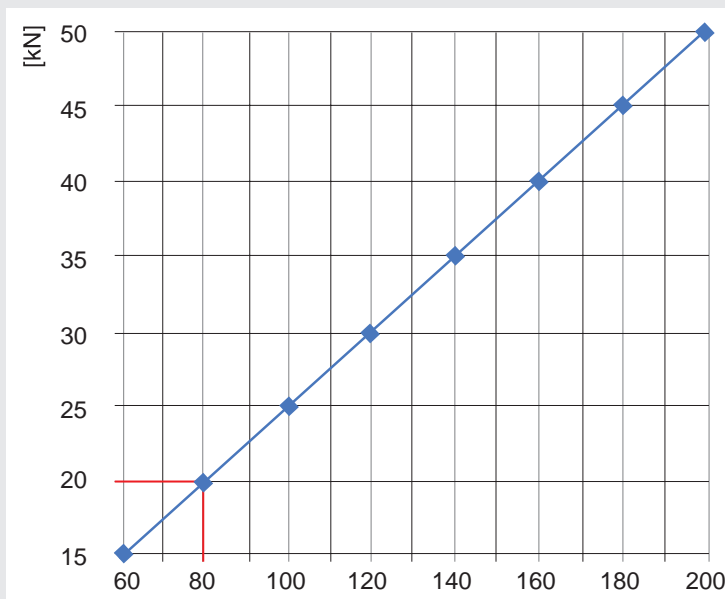**Clamping force / clamping pressure diagram****Example calculation:**

Hydraulic clamping pressure = 80bar. According to the diagram this will give a clamping force of 20,000N.

**Fail-safe:**

The system 3000 is not self-locking. If all lines are switched to the tank the pallet can be removed with a low force of 300N.



# Technical data - Tilting torque example calculation


Profit from our specialist competence


**Example:**

Fast closing clamp plate 4x system 3000 with 200 x 200 spacing and max. feed force of 7kN with distance of 400mm and clamping pressure 80bar.

**Question:**

Due to the predominance of roughing work, the system is to be checked for double safety. Are the insertion force, number of fast closing clamps and the selected spacing right for this application?

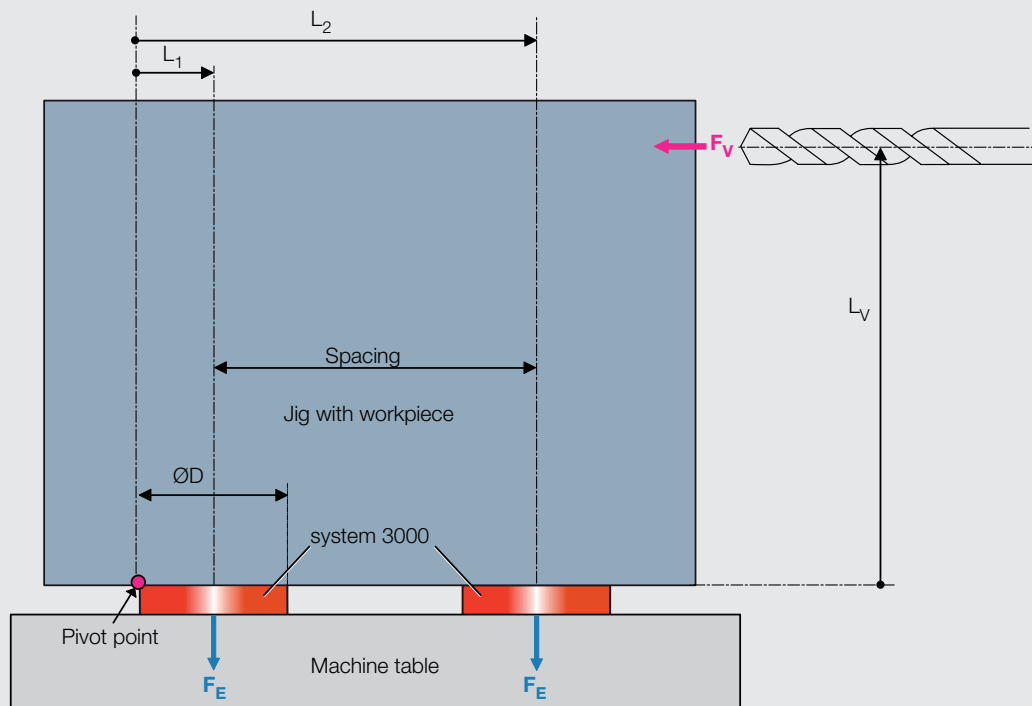
**Solution:**

$$M_E > 2 \times M_V ?$$

$$M_V = F_V \times L_V = 7.000\text{N} \times 0,4\text{m}$$

$$M_V = 2.800\text{Nm}$$

$$M_E = 2 \times (F_E \times L_1) + 2 \times (F_E \times L_2)$$

$$M_E = 2 \times F_E \times (L_1 + L_2)$$

$$L_1 = \text{ØD} / 2$$

$$L_2 = \text{ØD} / 2 + \text{Spacing}$$

$$L_1 + L_2 = \text{ØD} + \text{Spacing}$$

$$L_1 + L_2 = 0,12\text{m} + 0,200\text{m} = 0,32\text{m}$$

$$M_E = 2 \times F_E \times (L_1 + L_2) = 2 \times 20.000\text{N} \times 0,32\text{m}$$

$$M_E = 12800\text{Nm}$$

$$M_E / M_V > 2 ?$$

$$M_E / M_V = 12800\text{Nm} / 2.800\text{Nm}$$

$$M_E / M_V = 4,57 > 2$$

With this design, safety by around a factor of 4,57-times is provided.

The pressure could be reduced to 34bar to reach the double safety.

(All dimensions to be entered in SI units (metres, Newtons))

★ Insert at duct Ø85.

$M_V$  : Moment from feed force

$M_E$  : Moment from insertion force

$F_V$  : Feed force (7.000N)

$F_E$  : Insertion force (20.000N) at 80bar (s. p. i.7)

Spacing = 200mm = 0,20m

ØD : 125mm  $\approx$  0,12m★

$L_V$  : 400mm = 0,40m



## Function description SYSTEM 3000 –

### Positioning and clamping in one function




#### Principle of operation:

You can see the entire process at  
[www.stark-inc.com](http://www.stark-inc.com)


#### Move to system 3000:

Simple positioning of the pallet with  
 radial pre-centring of  $\pm 0.4\text{mm}$ .

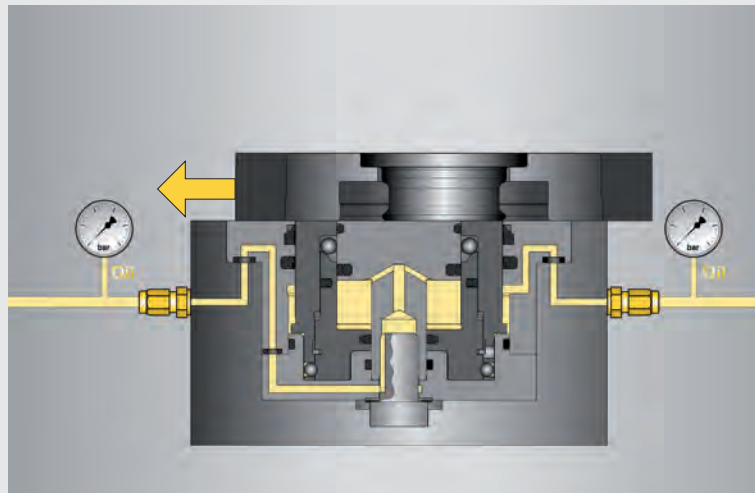


#### system 3000 clamped:

The piston is pressed up and during this  
 process positions the pallet precisely. The  
 inner piston follows (sequential control),  
 the ball chain clamps the clamping spigot  
 with its shape. The clamping pressure is  
 now applied to the system.

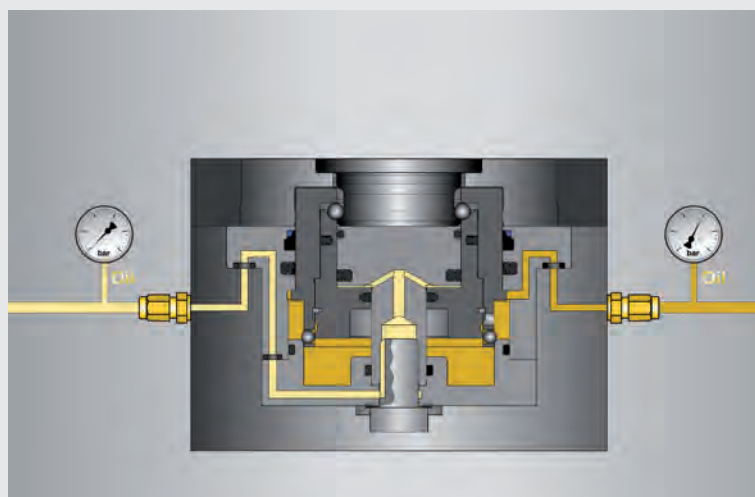

#### Release system 3000:

On releasing the inner piston moves  
 down, the ball chain releases the  
 clamping spigot, then the outer piston  
 is lowered and the pallet released.

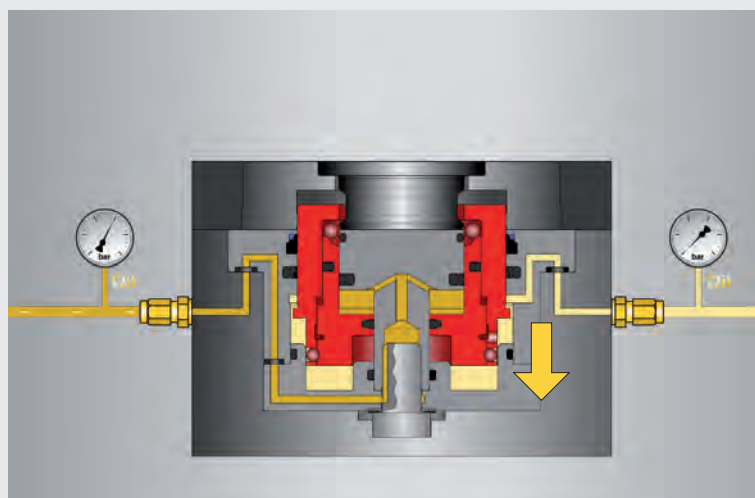



## Standard

- Module
- Raised supports
- Clearing device
- Pneumatic mount control
- Central locking



### Characteristics:

Flush Mount fast closing clamp module made of high quality tool steel.

Due to the compact dimensions, requires little space. Can be installed as a module, in plates or directly in the machine table. Double-action fast closing clamp, hydraulically clamped and released. Due to its short cycle times, particularly suitable for automation.


The oil feed is via the flange. Intelligent clearing system for cleaning the bearing surface and the precision bore. Mount control via differential pressure, blocking air possible.

### Application:

For flush mounting in machines, machine pallets, plates, angles, cubes, mounting towers and swivelling yokes.

Can be used for all common machining tasks such as milling, grinding, eroding as well as on test stands and mounting devices.

Ideal for automated loading.

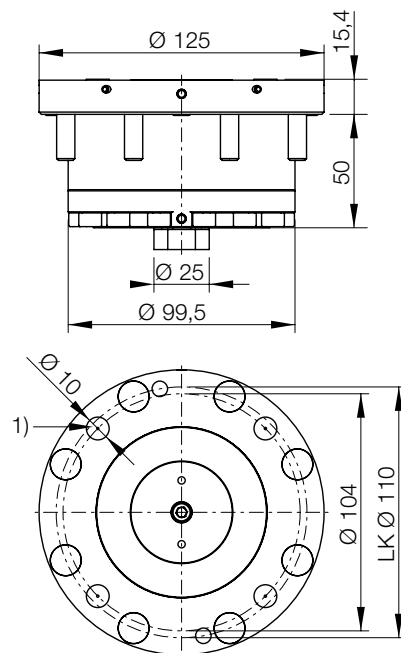

Z 3000 850

1) Raised supports with central clearing device (0.4mm high)


Order no.	Retention force	Clamping force	Pressure max. *	Weight	Data sheet
3000 850	50,000N	50,000N	200bar	3.75kg	D092

\* For pressure for releasing and clamping the system 3000 see also page i.6 and i.7.




### Practical example:

Mounted directly into the machine table. The pallet moves sideways, practically without lifting, onto the clamping element.

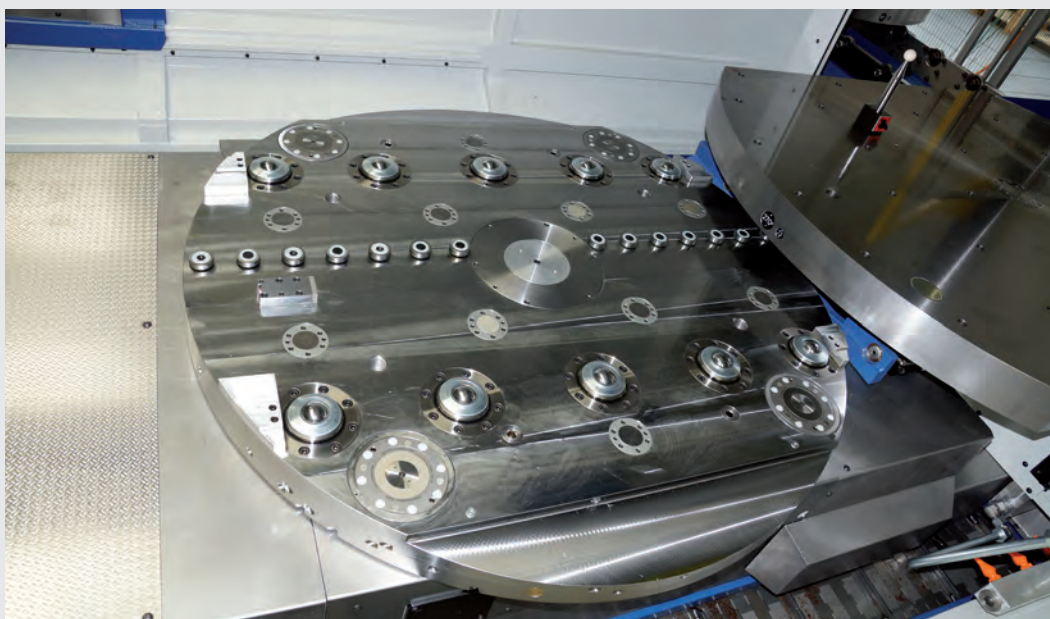

## Standard

- Module
- Raised supports
- Clearing device
- Pneumatic mount control
- Polling feature
- Central locking

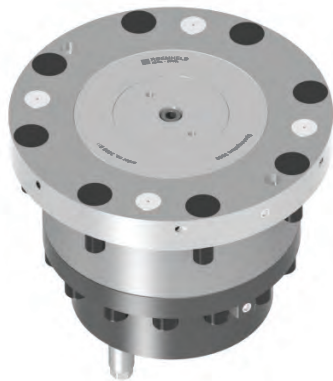

### Characteristics:



Flush Mount fast closing clamp module made of high quality tool steel.

Due to the compact dimensions, requires little space. Can be installed as a module, in plates or directly in the machine table. Double-action fast closing clamp. Is clamped and released hydraulically. Due to its short cycle times, particularly suitable for automation. The oil feed is via the flange. Intelligent clearing system for cleaning the bearing surface and the precision bore. Mount control via differential pressure, blocking air possible.

### Application:

For flush mounting in machines, machine pallets, plates, angles, cubes, mounting towers and swivelling yokes.

Can be used for all common machining tasks such as milling, grinding, eroding as well as on test stands and mounting devices. Ideal for automated loading.

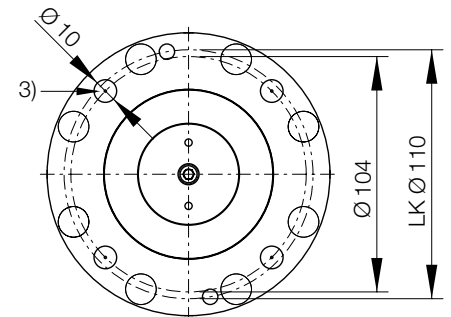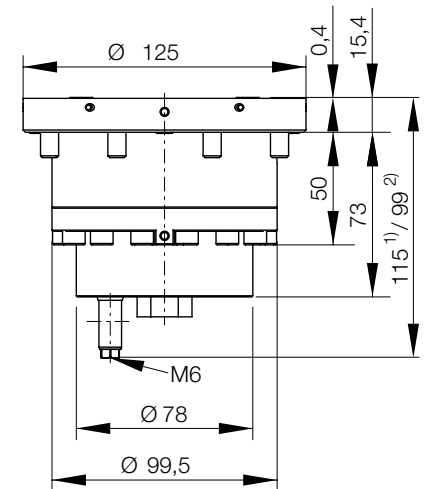

Z 3000 851

- 1) Polling pin released
- 2) Polling pin clamped
- 3) Raised supports with central clearing device (0.4mm high)


Order no.	Retention force	Clamping force	Pressure max. *	Weight	Data sheet
3000 851	50,000N	50,000N	200bar	4.45kg	D092

\* For pressure for releasing and clamping the system 3000 see also page i.6 and i.7.



### Practical example:

system 3000 completely recessed into machine table.

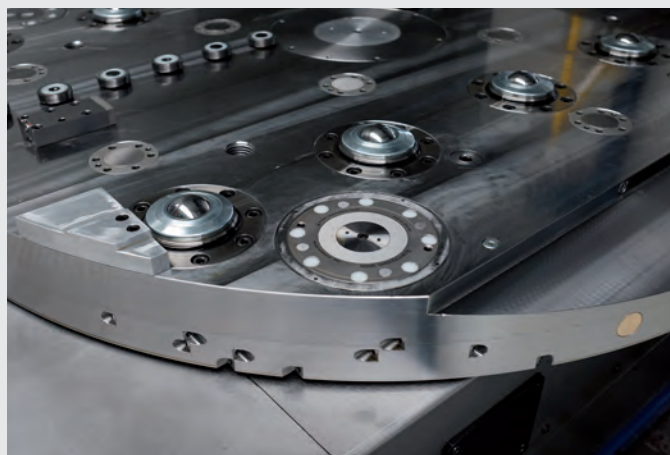






## Standard

- Module
- Bearing ring
- Central locking

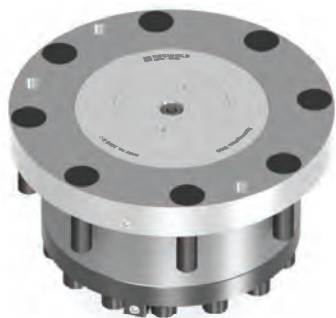

### Characteristics:



Flush Mount fast closing clamp module made of high quality tool steel.

Due to the compact dimensions, requires little space. Can be installed as a module, in plates or directly in the machine table. Double-action fast closing clamp. Is clamped and released hydraulically. Due to its short cycle times, particularly suitable for automation. The oil feed is via the flange.

### Application:

For flush mounting in machine pallets, plates, angles, cubes, towers and swivelling yokes.

Can be used for all common machining tasks such as milling, turning, grinding, eroding as well as on test stands for mounting devices. Ideal for automated loading.

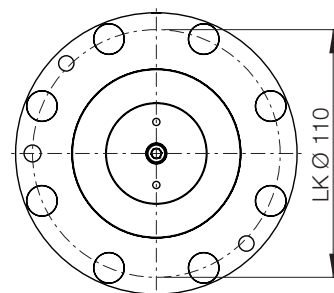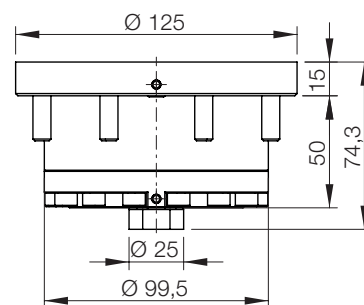

Z 3000 852

Order no.	Retention force	Clamping force	Pressure max. *	Weight	Data sheet
3000 852	50,000N	50,000N	200bar	3.75kg	D092

\* For pressure for releasing and clamping the system 3000 see also page i.6 and i.7.



### Practical example:



Integrated system 3000 with cones for pre-centring.



Usage of the system 3000 in a custom machine in the automotive manufacturing sector. The task of the fast changing element is to clamp and position a work-piece carrier in an integrated universal press up to 50kN. The stipulated cycle times for the press-fitting processes are 5 seconds.



The advantage of the element in this example is the magnitude of the clamping force in relation to the installation volume as well as the dirt-resistant smooth surface. A further option is the contact-free polling of the clamping element.

## Standard

- Module
- Bearing ring
- Central locking
- Pipe connection



### Characteristics:


Flush Mount fast closing clamp module made of high quality tool steel.

Due to the compact dimensions, requires little space. Can be installed as a module, in plates or directly in the machine table. Double-action fast closing clamp. Is clamped and released hydraulically. Due to its short cycle times, particularly suitable for automation. The oil feed is via the flange or the base.

### Application:

For flush mounting in machine pallets, plates, angles, cubes, towers and swiveling yokes.

Can be used for all common machining tasks such as milling, turning, grinding, eroding as well as on test stands for mounting devices. Ideal for automated loading.

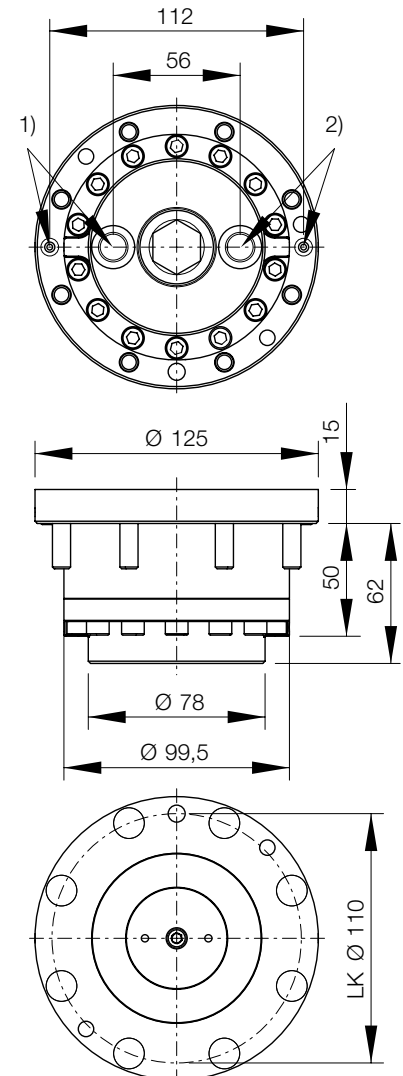

Z 3000 853

- 1) Release connection via O-ring or thread 1/4"
- 2) Clamp connection via O-ring or thread 1/4"

Order no.	Retention force	Clamping force	Pressure max.	* Weight	Data sheet
3000 853	50,000N	50,000N	200bar	3.75kg	D092


\* For pressure for releasing and clamping the system 3000 see also page i.6 and i.7.





## Clamping spigot

- With zero point
- With retaining ring

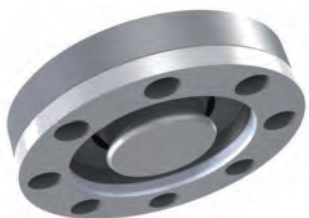


### Characteristics:

Clamping spigot with zero point.

### Application:

For positioning and clamping on machine pallets, machine vices, chucks, jigs, direct workpiece clamping.

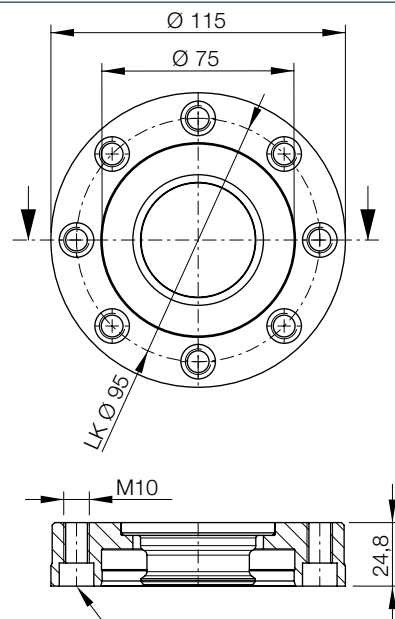


Z 3000 818

1) 8 counterbores for screws DIN 912, M8

Order no.	Screw quality	Tightening torque at the screw	Weight	Data sheet
3000 818	min. 10.9	48Nm	1.5kg	D093

## Clamping spigot

- With equaliser
- With retaining ring

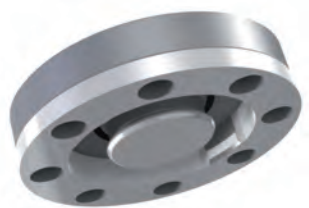


### Characteristics:

Clamping spigot with equaliser.

### Application:

For positioning and clamping on machine pallets, machine vices, chucks, jigs, direct workpiece clamping.

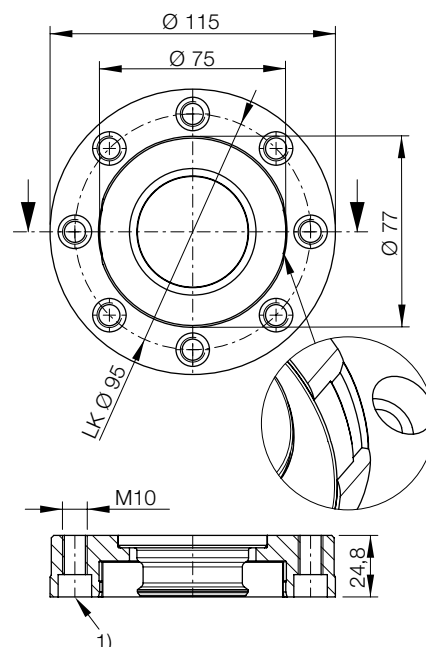


Z 3000 811

1) 8 counterbores for screws DIN 912, M8

Order no.	Screw quality	Tightening torque at the screw	Weight	Data sheet
3000 811	min. 10.9	48Nm	1.5kg	D093

## Clamping spigot

### ● With retaining ring

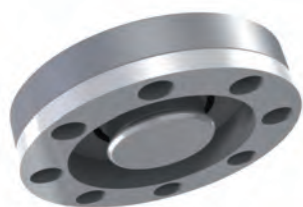


#### Characteristics:

Clamping spigot without centring.

#### Application:

For positioning and clamping on machine pallets, machine vices, chucks, jigs, direct workpiece clamping.

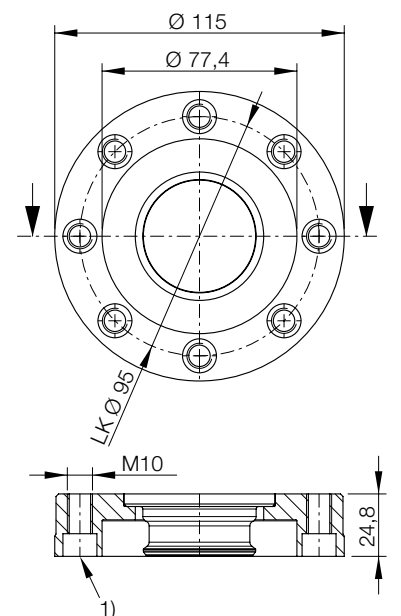


Z 3000 812


1) 8 counterbores for screws DIN 912, M8

Order no.	Screw quality	Tightening torque at the nipple	Tightening torque at the screw	Weight	Data sheet
3000 812	min. 10.9	73Nm	48Nm	1.5kg	D093


## Zero point clamping

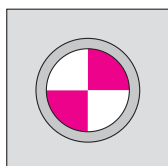

1)

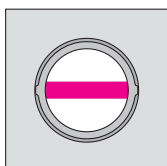


2)

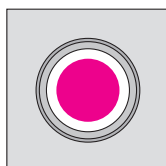

3)

- 1) Clamping spigot with zero point
- 2) Clamping spigot with equaliser
- 3) Clamping spigot without centring

### Clamping spigot with zero point at the top left corner of the pallet

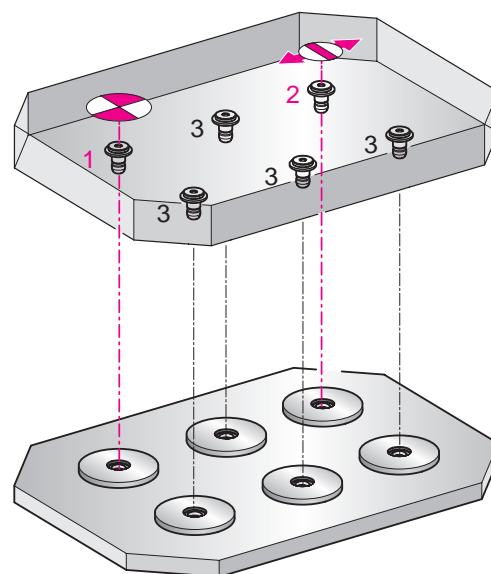

#### Application:

Equalisation of thermal expansion and manufacturing tolerances.



## Clamping spigot

- Without centring  $\pm 1$  mm
- With retaining ring




**Info:** For sketch see previous page.

### Characteristics:

Clamping spigot without centring  $\pm 1$  mm.

### Application:

For positioning and clamping on machine pallets, machine vices, chucks, jigs, direct workpiece clamping.

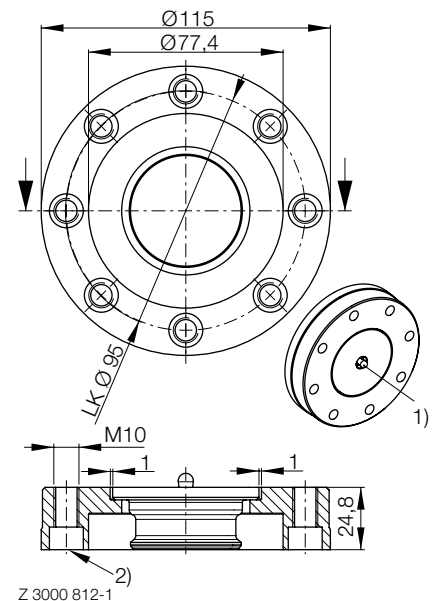

Z 3000 812-1

1) Spring pressure piece

2) 8 counterbores for screws DIN 912, M8

Order no.	Screw quality	Tightening torque at the nipple	Tightening torque at the screw	Weight	Data sheet
3000 812-1	min. 10.9	73Nm	48Nm	1.5kg	D093

## Ball ring for system 3000



### Characteristics:

Ball ring component with round wire ring and 36 balls with flats.

### Application:

For clamping and releasing the clamping spigot.


Order no.

3000 901



### Your advantages:

Easy replacement in accordance with operating instructions WM-020-309.

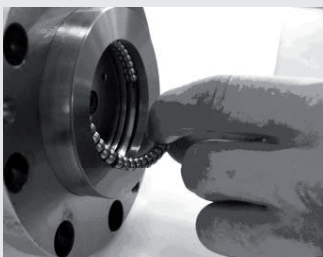

**1)** Pull off the ball ring using two fingers.



**2)** Lightly grease the ball ring prior to assembly. Fit the bottom end of the replacement ball ring in the groove.



**3)** Snap ball ring into the groove.

Only the original ...



...fits together!

**For this reason our customers receive:**

- A manufacturer's guarantee
- A function guarantee
- Warranty protection
- A range of fits







**ROEMHELD**  
HILMA ■ STARK

## STARK zero point clamping systems



*Consultation, planning, design, production, mounting, service – everything from a single source!*

Cost savings in manufacturing are these days increasingly only possible during machine set-up and by shortening the process times. Your production will be significantly faster if you use zero point clamping systems.

Key aspects such as focusing on bottlenecks (TOC), the reduction of cycle times, batch sizes and inventories, to name but a few of the advantages, are implemented quickly in manufacturing by using STARK zero point clamping systems.

Utilise the many years of experience and flexibility of specialists in zero point clamping technology to optimise your production.

The double-action clamping system 3000 is robust in use and designed for the fastest possible changing processes. Due to the compact design the system 3000 only requires little installation volume, as such close spacings are possible.

High position accuracy is therefore guaranteed.

Push on, pre-position, clamp, release – system 3000 everything is integrated into a hydraulic zero point clamping system.

*"We are very satisfied with the collaboration. Starting from the constructive conversations during the planning phase to the on-site service."*

*Rainer Frisch, Lewa Attendorf*

### **STARK Spannsysteme GmbH**

Römergrund 14

6830 Rankweil

Austria

Tel. +43 5522 37 400-0

Fax +43 5522 37 400-700

info@stark-inc.com

www.stark-inc.com